

# OCEANIC®

## FIRMWARE UPDATE RELEASE DETAILS

### VT 4.0

Dive Computers

to version 1B02

(from previous version 1A01)

#### EXPLANATION

In response to input received from users of the VT 4.0, Oceanic has modified the following items to improve the VT 4.0's operation:

- Edited information that is to appear on the screen during Buddy Pressure Check when the buddy is out of range during the time that the check is made, subsequent to having made the check previously.

*The graphic message BUDDY 1 (or 2) NOT AVAILABLE is now displayed instead of the graphics BUDDY 1 (or 2) PRESSURE with the previous value received.*

- Reduced the time required to acquire a Buddy link signal, which was as long as 16 seconds (10 seconds minimum), to less than 10 seconds (1 second minimum).
- Eliminated flashing of ATR digits which occurred upon return of the Main Dive screen after a Buddy Pressure Check.
- Eliminated repeat of the Deco alarm which occurred upon return of the Deco Main screen after a Buddy Pressure Check.
- Eliminated intermittent display of dashes in place of pressure during Buddy Pressure Check.
- Eliminated a number 1 digit which carried over from ATR on the Dive Main screen to Compass Mode.

#### UPDATE PROCESS

Units affected are the VT 4.0 containing previous firmware revision 1A01.

In the event that you have experienced the above, or you want to be sure it doesn't occur, you can update your VT 4.0's firmware (operating software program) to newly released revision 1B02 using the *Check for new Firmware Update* feature of the current version of the OceanLog PC interface program. There is no need to return the unit to Oceanic.

*OceanLog is available on the [www.oceanicworldwide.com](http://www.oceanicworldwide.com) web site.*

Should you have any questions, please contact your Authorized Oceanic Dealer, or Oceanic Customer Service by calling 800-435-3483 (8AM -5PM, PST Monday - Friday) or send an email to [service@oceanicusa.com](mailto:service@oceanicusa.com).